


Certificate of Analysis **IARM 252F**

AISI 8740 / UNS G87400 **Certified Reference Material**

Certified Values listed in wt.% with associated uncertainties

ΑΙ	0.026 ± 0.002	As	0.006 ± 0.004	С	0.406 ± 0.009	Со	0.0086 ± 0.0008
Cr	0.463 ± 0.008	Cu	0.182 ± 0.006	Mn	0.88 ± 0.02	Мо	0.210 ± 0.002
Ν	0.0059 ± 0.0005	Nb	0.0016 ± 0.0005	Ni	0.412 ± 0.004	Ρ	0.011 ± 0.002
S	0.009 ± 0.001	Si	0.247 ± 0.007	Sn	0.008 ± 0.001	Ti	0.0010 ± 0.0004
V	0.003 ± 0.001	W	0.003 ± 0.001				

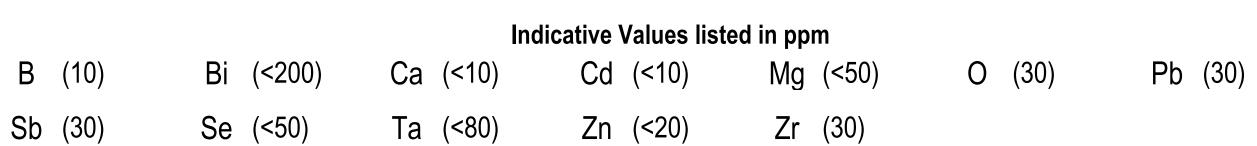

Description and Intended Use

This CRM may come in the form of a solid disc or chips. The intended use of this CRM may include, but is not limited to, the calibration of instruments and the validation of analytical methods.

Interpretation of Data

- 1. Certified values listed reflect analysis results submitted by qualified analytical laboratories using a combination of methods and instrumentation that emulate actual methods and instrumental techniques currently utilized in the analytical community, and are reported as wt% unless otherwise noted.
- 2. This material was tested using both the solid disks and chips prepared from individual sections of bar. The certified values are considered representative of the overall average composition of the material.
- 3. Any data reported and enclosed by a parentheses () is a "best estimate" and is not certified. This data could not be quantified sufficiently for certification. It was, however, reported by enough laboratories to be considered as potentially present in the matrix of the material being examined.
- 4. "Provisional Certificate of Analysis" reports values that support a fully certified reference material; it also indicates that values may be in a continued process of statistical evaluation and are subject to change.
- 5. Chips are not certified for Oxygen analysis.



Analytical Reference Materials International • 276 Abby Road • Manchester, NH 03103 252F-01312018-IARM-F Telephone (603) 935-4100 • Fax (603) 935-4101 • www.ARMI.com • ARMI@LGCgroup.com 1/31/2018 1/3

	AI	As	В	Bi	С	Са	Cd	Со	Cr	Cu	Mg	Mn	Мо	N	Nb	Ni
1	0.023	0.002	0.00013	0.0018	0.3754	0.00012	<0.0001	0.007	0.452	0.17	0.0005	0.843	0.205	0.005	0.00085	0.402
2	0.02303	0.0023	0.00017	0.014	0.3965	0.0003	<0.001	0.0076	0.453	0.17489	0.003	0.8495	0.2054	0.00564	0.001	0.404
3	0.024	0.0039	0.00024	<0.001	0.397	<0.0005	<0.001	0.008	0.453	0.175	<0.0005	0.86	0.2087	0.0057	0.00147	0.406
4	0.024	0.0041	0.0006	<0.001	0.4082			0.00805	0.4531	0.176	<0.005	0.8615	0.2088	0.006	0.0018	0.4096
5	0.025	0.00446	0.0026		0.41			0.0081	0.457	0.178		0.8637	0.209	0.006	0.0019	0.41
6	0.0252	0.0045	<0.0005		0.411			0.0081	0.46	0.1796		0.865	0.209	0.00652	0.002	0.4115
7	0.0268	0.0051	<0.0005		0.412			0.0089	0.4608	0.1805		0.8694	0.2093	0.0066	0.0022	0.415
8	0.027	0.0104	<0.001		0.413			0.0094	0.4608	0.1809		0.874	0.21		<0.001	0.41629
9	0.0293	0.0178	<0.001		0.4154			0.0095	0.4635	0.183		0.8816	0.212		<0.001	0.418
10	0.0304	<0.001			0.4189			0.011	0.4635	0.1853		0.889	0.2124		<0.005	0.42
11	0.0323	<0.005							0.4841	0.1951		0.9427	0.215			0.42
12									0.4918	0.2051		0.9574				
13																
14																
15																
Mean	0.026	0.006	0.001	0.010	0.406	0.0002		0.0086	0.463	0.182	0.002	0.88	0.21	0.0059	0.0016	0.412
STDV.	0.003	0.005	0.001	0.009	0.01	0.0001		0.001	0.01	0.01	0.002	0.04	0.003	0.0005	0.0005	0.006
Certified	0.026	0.006	(0.001)	(<0.02)	0.406	(<0.001)	(<0.001)	0.0086	0.463	0.182	(<0.005)	0.88	0.210	0.0059	0.0016	0.412
95% C.I.	0.002	0.004			0.009	_		0.0008	0.008	0.006	_	0.02	0.002	0.0005	0.0005	0.004
Methods	X,O,I	X,O,I,A	O,I	O,I,A	O,C	O,I	I,A	X,O,I	X,O,I	X,O,I	O,I	X,O,I	X,O,I	F	X,O,I	X,O,I
	, - ,	, , - , ,	- ,-	•,.,, ·	•,•	0,		, , e ,.	7,0,1	, , o ,.	-)	, -, -	, -, -		1 - 1	, - ,
				•		•						-	·	Zr	, <u>, ,</u>	
1	0	P 0.0079	Pb	S 0.0057	Sb 0.0013	Se	Si	Sn 0.0059	Ta	Ti	V	W 0.002	Zn	Zr 0.00102	, - ,	
1 2		Р		S	Sb	•		Sn	Та	Ti		W	·	Zr 0.00102 0.002	, - ,	
1	O 0.0005	P 0.0079	Pb 0.0005	S 0.0057	Sb 0.0013	Se 0.0017	Si 0.2337	Sn 0.0059	Ta <0.001	Ti 0.0004	V 0.0023	W 0.002	Zn 0.0004	0.00102 0.002		
1 2	O 0.0005 0.00053	P 0.0079 0.00828	Pb 0.0005 0.0005	S 0.0057 0.006	Sb 0.0013 0.00138	Se 0.0017 <0.001	Si 0.2337 0.2363	Sn 0.0059 0.007	Ta <0.001 <0.001	Ti 0.0004 0.000746	V 0.0023 0.00238	W 0.002 0.0021	Zn 0.0004 0.0004	0.00102	, , ,	
1 2	O 0.0005 0.00053 0.0012	P 0.0079 0.00828 0.0083	Pb 0.0005 0.0005 0.0043	S 0.0057 0.006 0.0075	Sb 0.0013 0.00138 0.0022	Se 0.0017 <0.001 <0.001	Si 0.2337 0.2363 0.2375	Sn 0.0059 0.007 0.008	Ta <0.001 <0.001 <0.001	Ti 0.0004 0.000746 0.00095	V 0.0023 0.00238 0.0026	W 0.002 0.0021 0.0023	Zn 0.0004 0.0004 <0.0005	0.00102 0.002 0.004		
1 2 3 4	O 0.0005 0.00053 0.0012 0.0053	P 0.0079 0.00828 0.0083 0.0096	Pb 0.0005 0.0005 0.0043 0.006	S 0.0057 0.006 0.0075 0.00945	Sb 0.0013 0.00138 0.0022 0.0025	Se 0.0017 <0.001 <0.001 <0.001	Si 0.2337 0.2363 0.2375 0.2434	Sn 0.0059 0.007 0.008 0.0086	Ta <0.001 <0.001 <0.001 <0.002	Ti 0.0004 0.000746 0.00095 0.001	V 0.0023 0.00238 0.0026 0.003	W 0.002 0.0021 0.0023 0.003	Zn 0.0004 0.0004 <0.0005 <0.001	0.00102 0.002 0.004 0.0049	, , ,	
1 2 3 4 5	O 0.0005 0.00053 0.0012 0.0053 0.007	P 0.0079 0.00828 0.0083 0.0096 0.0097	Pb 0.0005 0.0005 0.0043 0.006 <0.001	S 0.0057 0.006 0.0075 0.00945 0.0095	Sb 0.0013 0.00138 0.0022 0.0025 0.0088	Se 0.0017 <0.001 <0.001 <0.001	Si 0.2337 0.2363 0.2375 0.2434 0.244	Sn 0.0059 0.007 0.008 0.0086 0.0086	Ta <0.001 <0.001 <0.001 <0.002	Ti 0.0004 0.000746 0.00095 0.001 0.00119	V 0.0023 0.00238 0.0026 0.003 0.00314	W 0.002 0.0021 0.0023 0.003 0.003248	Zn 0.0004 0.0004 <0.0005 <0.001	0.00102 0.002 0.004 0.0049 <0.0005	, , ,	
1 2 3 4 5	O 0.0005 0.00053 0.0012 0.0053 0.007	P 0.0079 0.00828 0.0083 0.0096 0.0097 0.0098	Pb 0.0005 0.0005 0.0043 0.006 <0.001	S 0.0057 0.006 0.0075 0.00945 0.0095 0.0095	Sb 0.0013 0.00138 0.0022 0.0025 0.0088	Se 0.0017 <0.001 <0.001 <0.001	Si 0.2337 0.2363 0.2375 0.2434 0.244 0.247	Sn 0.0059 0.007 0.008 0.0086 0.0086 0.0086	Ta <0.001 <0.001 <0.001 <0.002	Ti 0.0004 0.000746 0.00095 0.001 0.00119 0.0016	V 0.0023 0.00238 0.0026 0.003 0.00314 0.004	W 0.002 0.0021 0.0023 0.003 0.003248 0.00328	Zn 0.0004 0.0004 <0.0005 <0.001	0.00102 0.002 0.004 0.0049 <0.0005		
1 2 3 4 5	O 0.0005 0.00053 0.0012 0.0053 0.007	P 0.0079 0.00828 0.0083 0.0096 0.0097 0.0098 0.01	Pb 0.0005 0.0005 0.0043 0.006 <0.001	S 0.0057 0.006 0.0075 0.00945 0.0095 0.0095 0.00994	Sb 0.0013 0.00138 0.0022 0.0025 0.0088	Se 0.0017 <0.001 <0.001 <0.001	Si 0.2337 0.2363 0.2375 0.2434 0.244 0.247 0.247	Sn 0.0059 0.007 0.008 0.0086 0.0086 0.0086 0.0087	Ta <0.001 <0.001 <0.001 <0.002	Ti 0.0004 0.000746 0.00095 0.001 0.00119 0.0016 <0.001	V 0.0023 0.00238 0.0026 0.003 0.00314 0.004 0.0047	W 0.002 0.0021 0.0023 0.003 0.003248 0.00328 0.0056	Zn 0.0004 0.0004 <0.0005 <0.001	0.00102 0.002 0.004 0.0049 <0.0005		
1 2 3 4 5	O 0.0005 0.00053 0.0012 0.0053 0.007	P 0.0079 0.00828 0.0083 0.0096 0.0097 0.0098 0.01 0.0107	Pb 0.0005 0.0005 0.0043 0.006 <0.001	S 0.0057 0.006 0.0075 0.00945 0.0095 0.0095 0.00994 0.01113 0.01129 0.0114	Sb 0.0013 0.00138 0.0022 0.0025 0.0088	Se 0.0017 <0.001 <0.001 <0.001	Si 0.2337 0.2363 0.2375 0.2434 0.244 0.247 0.247 0.247 0.248 0.2482 0.25	Sn 0.0059 0.007 0.008 0.0086 0.0086 0.0086 0.0087 0.0088	Ta <0.001 <0.001 <0.001 <0.002	Ti 0.0004 0.000746 0.00095 0.001 0.00119 0.0016 <0.001 <0.001	V 0.0023 0.00238 0.0026 0.003 0.00314 0.004 0.0047 0.0056	W 0.002 0.0021 0.0023 0.003 0.003248 0.00328 0.0056	Zn 0.0004 0.0004 <0.0005 <0.001	0.00102 0.002 0.004 0.0049 <0.0005		
1 2 3 4 5 6 7 8 9	O 0.0005 0.00053 0.0012 0.0053 0.007	P 0.0079 0.00828 0.0083 0.0096 0.0097 0.0098 0.01 0.0107 0.011	Pb 0.0005 0.0005 0.0043 0.006 <0.001	S 0.0057 0.006 0.0075 0.00945 0.0095 0.0095 0.00994 0.01113 0.01129	Sb 0.0013 0.00138 0.0022 0.0025 0.0088	Se 0.0017 <0.001 <0.001 <0.001	Si 0.2337 0.2363 0.2375 0.2434 0.244 0.247 0.247 0.247 0.248 0.248 0.2482 0.25 0.262	Sn 0.0059 0.007 0.008 0.0086 0.0086 0.0086 0.0087 0.0088	Ta <0.001 <0.001 <0.001 <0.002	Ti 0.0004 0.000746 0.00095 0.001 0.00119 0.0016 <0.001 <0.001	V 0.0023 0.00238 0.0026 0.003 0.00314 0.004 0.0047 0.0056 <0.005	W 0.002 0.0021 0.0023 0.003 0.003248 0.00328 0.0056	Zn 0.0004 0.0004 <0.0005 <0.001	0.00102 0.002 0.004 0.0049 <0.0005		
1 2 3 4 5 6 7 8 9 10	O 0.0005 0.00053 0.0012 0.0053 0.007	P 0.0079 0.00828 0.0083 0.0096 0.0097 0.0098 0.01 0.0107 0.011 0.011	Pb 0.0005 0.0005 0.0043 0.006 <0.001	S 0.0057 0.006 0.0075 0.00945 0.0095 0.0095 0.00994 0.01113 0.01129 0.0114	Sb 0.0013 0.00138 0.0022 0.0025 0.0088	Se 0.0017 <0.001 <0.001 <0.001	Si 0.2337 0.2363 0.2375 0.2434 0.244 0.247 0.247 0.247 0.248 0.2482 0.25	Sn 0.0059 0.007 0.008 0.0086 0.0086 0.0086 0.0087 0.0088	Ta <0.001 <0.001 <0.001 <0.002	Ti 0.0004 0.000746 0.00095 0.001 0.00119 0.0016 <0.001 <0.001	V 0.0023 0.00238 0.0026 0.003 0.00314 0.004 0.0047 0.0056 <0.005	W 0.002 0.0021 0.0023 0.003 0.003248 0.00328 0.0056	Zn 0.0004 0.0004 <0.0005 <0.001	0.00102 0.002 0.004 0.0049 <0.0005		
1 2 3 4 5 6 7 8 9 10 11 12 13	O 0.0005 0.00053 0.0012 0.0053 0.007	P 0.0079 0.00828 0.0083 0.0096 0.0097 0.0098 0.01 0.0107 0.011 0.014 0.015	Pb 0.0005 0.0005 0.0043 0.006 <0.001	S 0.0057 0.006 0.0075 0.00945 0.0095 0.0095 0.00994 0.01113 0.01129 0.0114	Sb 0.0013 0.00138 0.0022 0.0025 0.0088	Se 0.0017 <0.001 <0.001 <0.001	Si 0.2337 0.2363 0.2375 0.2434 0.244 0.247 0.247 0.247 0.248 0.248 0.2482 0.25 0.262	Sn 0.0059 0.007 0.008 0.0086 0.0086 0.0086 0.0087 0.0088	Ta <0.001 <0.001 <0.001 <0.002	Ti 0.0004 0.000746 0.00095 0.001 0.00119 0.0016 <0.001 <0.001	V 0.0023 0.00238 0.0026 0.003 0.00314 0.004 0.0047 0.0056 <0.005	W 0.002 0.0021 0.0023 0.003 0.003248 0.00328 0.0056	Zn 0.0004 0.0004 <0.0005 <0.001	0.00102 0.002 0.004 0.0049 <0.0005		
1 2 3 4 5 6 7 8 9 10 11 12	O 0.0005 0.00053 0.0012 0.0053 0.007	P 0.0079 0.00828 0.0083 0.0096 0.0097 0.0098 0.01 0.0107 0.011 0.014 0.015	Pb 0.0005 0.0005 0.0043 0.006 <0.001	S 0.0057 0.006 0.0075 0.00945 0.0095 0.0095 0.00994 0.01113 0.01129 0.0114	Sb 0.0013 0.00138 0.0022 0.0025 0.0088	Se 0.0017 <0.001 <0.001 <0.001	Si 0.2337 0.2363 0.2375 0.2434 0.244 0.247 0.247 0.247 0.248 0.248 0.2482 0.25 0.262	Sn 0.0059 0.007 0.008 0.0086 0.0086 0.0086 0.0087 0.0088	Ta <0.001 <0.001 <0.001 <0.002	Ti 0.0004 0.000746 0.00095 0.001 0.00119 0.0016 <0.001 <0.001	V 0.0023 0.00238 0.0026 0.003 0.00314 0.004 0.0047 0.0056 <0.005	W 0.002 0.0021 0.0023 0.003 0.003248 0.00328 0.0056	Zn 0.0004 0.0004 <0.0005 <0.001	0.00102 0.002 0.004 0.0049 <0.0005		
1 2 3 4 5 6 7 8 9 10 11 12 13	O 0.0005 0.00053 0.0012 0.0053 0.007 <0.005	P 0.0079 0.00828 0.0083 0.0096 0.0097 0.0098 0.01 0.0107 0.011 0.011 0.014 0.015 0.0163	Pb 0.0005 0.0043 0.006 <0.001 <0.0010	S 0.0057 0.006 0.0075 0.00945 0.0095 0.0095 0.00994 0.01113 0.01129 0.0114 0.012	Sb 0.0013 0.00138 0.0022 0.0025 0.0088 <0.001	Se 0.0017 <0.001 <0.001 <0.001	Si 0.2337 0.2363 0.2375 0.2434 0.244 0.247 0.247 0.247 0.248 0.2482 0.2482 0.25 0.262 0.2705	Sn 0.0059 0.007 0.008 0.0086 0.0086 0.0086 0.0087 0.0088 0.011	Ta <0.001 <0.001 <0.001 <0.002	Ti 0.0004 0.000746 0.00095 0.001 0.00119 0.0016 <0.001 <0.001 <0.005	V 0.0023 0.00238 0.0026 0.003 0.00314 0.004 0.0047 0.0056 <0.005 <0.005	W 0.002 0.0021 0.0023 0.003 0.003248 0.00328 0.0056 <0.005	Zn 0.0004 0.0004 <0.0005 <0.001	0.00102 0.002 0.004 0.0049 <0.0005 <0.002		
1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 Mean	O 0.0005 0.00053 0.0012 0.0053 0.007 <0.005	P 0.0079 0.00828 0.0083 0.0096 0.0097 0.0098 0.01 0.0107 0.011 0.014 0.015 0.0163	Pb 0.0005 0.0043 0.006 <0.001 <0.0010 0.003	S 0.0057 0.006 0.0075 0.00945 0.0095 0.0095 0.00994 0.01113 0.01129 0.0114 0.012	Sb 0.0013 0.00138 0.0022 0.0025 0.0088 <0.001	Se 0.0017 <0.001 <0.001 <0.001	Si 0.2337 0.2363 0.2375 0.2434 0.244 0.247 0.247 0.247 0.248 0.2482 0.25 0.262 0.2705	Sn 0.0059 0.007 0.008 0.0086 0.0086 0.0087 0.0088 0.011	Ta <0.001 <0.001 <0.001 <0.002	Ti 0.0004 0.000746 0.00095 0.001 0.00119 0.0016 <0.001 <0.001 <0.005	V 0.0023 0.00238 0.0026 0.003 0.00314 0.004 0.0047 0.0056 <0.005 <0.005 <0.005	W 0.002 0.0021 0.003 0.003248 0.00328 0.0056 <0.005	Zn 0.0004 0.0004 <0.0005 <0.001	0.00102 0.002 0.004 0.0049 <0.0005 <0.002		
1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 Mean STDV.	O 0.0005 0.00053 0.0012 0.0053 0.007 <0.005 0.005	P 0.0079 0.00828 0.0083 0.0096 0.0097 0.0098 0.01 0.0107 0.011 0.014 0.015 0.0163	Pb 0.0005 0.0043 0.006 <0.001 <0.0010 0.003 0.003	S 0.0057 0.006 0.0075 0.00945 0.0095 0.0095 0.00994 0.01113 0.01129 0.0114 0.012	Sb 0.0013 0.0022 0.0025 0.0088 <0.001	Se 0.0017 <0.001 <0.001 <0.005	Si 0.2337 0.2363 0.2375 0.2434 0.244 0.247 0.247 0.247 0.248 0.2482 0.25 0.262 0.2705 0.262 0.2705	Sn 0.0059 0.007 0.008 0.0086 0.0086 0.0086 0.0087 0.0088 0.011	Ta <0.001 <0.001 <0.002 <0.008	Ti 0.0004 0.000746 0.00095 0.001 0.00119 0.0016 <0.001 <0.001 <0.005	V 0.0023 0.00238 0.0026 0.003 0.00314 0.004 0.0047 0.0056 <0.005 <0.005 <0.005 <0.005	W 0.002 0.0021 0.003 0.003248 0.00328 0.0056 <0.005 <0.005	Zn 0.0004 0.0005 <0.001 <0.002	0.00102 0.002 0.004 0.0049 <0.0005 <0.002		
1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 Mean STDV. Certified	O 0.0005 0.00053 0.0012 0.0053 0.007 <0.005	P 0.0079 0.00828 0.0083 0.0096 0.0097 0.0098 0.01 0.0107 0.011 0.014 0.015 0.0163 0.0163	Pb 0.0005 0.0043 0.006 <0.001 <0.0010 0.003	S 0.0057 0.006 0.0075 0.00945 0.0095 0.0095 0.00994 0.01113 0.01129 0.0114 0.012 0.012	Sb 0.0013 0.00138 0.0022 0.0025 0.0088 <0.001	Se 0.0017 <0.001 <0.001 <0.001	Si 0.2337 0.2363 0.2375 0.2434 0.244 0.247 0.247 0.248 0.2482 0.248 0.2482 0.25 0.262 0.2705 0.262 0.2705	Sn 0.0059 0.007 0.008 0.0086 0.0086 0.0086 0.0087 0.0088 0.011 0.008 0.001 0.008	Ta <0.001 <0.001 <0.001 <0.002	Ti 0.0004 0.000746 0.00095 0.001 0.00119 0.0016 <0.001 <0.001 <0.005	V 0.0023 0.00238 0.0026 0.003 0.00314 0.0047 0.0056 <0.005	W 0.002 0.0021 0.0023 0.003 0.003248 0.00328 0.0056 <0.005 0.005 0.003 0.001 0.003	Zn 0.0004 0.0004 <0.0005 <0.001	0.00102 0.002 0.004 0.0049 <0.0005 <0.002		
1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 Mean STDV.	O 0.0005 0.00053 0.0012 0.0053 0.007 <0.005 0.005	P 0.0079 0.00828 0.0083 0.0096 0.0097 0.0098 0.01 0.0107 0.011 0.014 0.015 0.0163	Pb 0.0005 0.0043 0.006 <0.001 <0.0010 0.003 0.003	S 0.0057 0.006 0.0075 0.00945 0.0095 0.0095 0.00994 0.01113 0.01129 0.0114 0.012	Sb 0.0013 0.0022 0.0025 0.0088 <0.001	Se 0.0017 <0.001 <0.001 <0.005	Si 0.2337 0.2363 0.2375 0.2434 0.244 0.247 0.247 0.247 0.248 0.2482 0.25 0.262 0.2705 0.262 0.2705	Sn 0.0059 0.007 0.008 0.0086 0.0086 0.0086 0.0087 0.0088 0.011	Ta <0.001 <0.001 <0.002 <0.008	Ti 0.0004 0.000746 0.00095 0.001 0.00119 0.0016 <0.001 <0.001 <0.005	V 0.0023 0.00238 0.0026 0.003 0.00314 0.004 0.0047 0.0056 <0.005 <0.005 <0.005 <0.005	W 0.002 0.0021 0.003 0.003248 0.00328 0.0056 <0.005 <0.005	Zn 0.0004 0.0005 <0.001 <0.002	0.00102 0.002 0.004 0.0049 <0.0005 <0.002		

The following data and accompanying statements represent all pertinent information reported in the ILAP as it applies to the chemical characterization of this material.

Legend: W = Classical, C = Combustion, F = Fusion, A = AA or GFAA, I = ICP or DCP, IM=ICP-MS, D = DC Arc, O = AES, X = XRF, G = GDAES or GDMS, H = Hollow Cathode AES



Analytical Reference Materials International • 276 Abby Road • Manchester, NH 03103 252F-01312018-IARM-F Telephone (603) 935-4100 • Fax (603) 935-4101 • www.ARMI.com • ARMI@LGCgroup.com 1/31/2018

2/3

Participating Laboratories

Abbey Forged Products Davis Alloys Manufacturing, LLC Laboratory Testing, Inc. Oxford Instruments Industrial Analysis VHG Labs Beeley Wood Works Sharpsville, PA Hatfield, PA Middleton, WI Manchester, NH Anderson Laboratories, Inc. Exova - Burlington Massachusetts Materials Research TimkenSteel Corporation Greendale, WI Burlington, ON West Boylston, MA Canton, OH

Traceability

Members of the "Inter-Laboratory Analysis Program" (ILAP) validate test methods and instrument performance utilizing SRMs, CRMs, and RMs produced by recognized Certifying Bodies. The specific SRMs, CRMs, and RMs applicable to the material covered by this certificate are:

ALPHA AR1648	BAS SS403-2	BS CSN 2-2	IARM 252C	LECO 501-646	NIST 132A	NIST 361	VHG 137386RR-1
ALPHA AR670	BAS SS404-2	BSHONT	IARM 28H	LECO 501-664	NIST 16F	NIST 362	VHG 80028-11
ALPHA AR676	BAS SS405-2	ELTRA 91100-1004	IARM 30F	LECO 502-016	NIST 1754	NIST 363	VHG 88387-12
ALPHA AR684	BAS SS59	IARM 241A	IARM 33A	MBH 128X 353C	NIST 1763	NIST 364	VHG 91231-8
ALPHA AR884	BS 50B	IARM 252A	LECO 501-502	MBH 12X 353C	NIST 1764	NIST 368	
BAS SS112	BS 8620C	IARM 252B	LECO 501-510	NIST 1263	NIST 1765	NIST 36B	

Homogeneity and Uncertainty

"Uncertainty" values, as reported adjacent to certified concentration values, are based on a 95% Confidence Interval. These estimated uncertainties include the combined effects of method imprecision, material inhomogeneity, and any bias between methods. Homogeneity data from experimental XRF results are reflected in both the overall statistics and certified data. Homogeneity samples are selected by a systematic sampling procedure. The number of samples may be determined by equation 1, where N_{prod} is the number of units produced and N_{min} is the number of samples used for homogeneity testing. These samples are arranged in a simple randomized design such that each sample is analyzed multiple times by XRF. Homogeneity is also determined within sample using an applied version of ASTM E826. A single factor ANOVA is used to calculated uncertainty due to inhomogeneity (U_{hom}). Uncertainty of the material is calculated by equation 2, where H=U_{hom}, S= Standard deviation, t= t-value at 95% CI, and n= number of observations.

1.
$$N_{min} = \max(10, \sqrt[3]{N_{prod}})$$

2. $U_{CRM} = \frac{\sqrt{H^2 + S^2}}{\sqrt{n}} * t$

The International Standards Organization (ISO) definitions, expressed in ISO Guide 30–1992 list the following:

Certifying Body: Any technically competent body (organization or firm, public or private) that issues a reference material certificate with the information detailed in ISO Guide 31. The only generally accepted certifying body in the United States for primary standards or Standard Reference Materials (SRM) is the U. S. Department of Commerce, National Institute of Standards & Technology (NIST), Gaithersburg, MD. All other certifying bodies in the United States produce Reference Materials (RM) or Certified Reference Materials (CRM).

Reference Material (RM): Material or substance, with one or more property values that are sufficiently homogeneous and well established, to be used for the calibration of an apparatus, the assessment of a measurement method, or for assigning values to materials.

Certified Reference Material (CRM): Reference material, accompanied by a certificate, with one or more property values certified by a procedure, which establishes its traceability to an accurate realization of the

Inter-Laboratory Analysis Program (ILAP): ASTM Standard E691-87 applies to inter-laboratory studies to "Determine the Precision of a Single Test Method", but also outlines a well thought out and logical plan for conducting an inter laboratory program involving multiple analytical techniques. Therefore, the guidelines established in ASTM E691-87 were applied to all aspects of this inter laboratory program, including the protocols for planning, handling, analysis and treatment of resulting data.

<u>Methods of Analysis</u>: The "Inter Laboratory Analysis Program" analyzes a wide variety of materials, and as a result, no single analytical method would provide optimum analytical results. Therefore, a combination of ASTM Standard Methods for classical wet chemistry, ICP, AA, Optical Emission, X-Ray spectrometric, and other accepted methods were used to produce analytical data. Carbon, Sulfur, Nitrogen, and Oxygen results were supplied from combustion and OE instrument procedures.

Expiration of Certification: The certification of this IARM is valid indefinitely, within the uncertainty specified, provided the IARM is handled and stored in accordance with the instructions stated on this certificate. The certification is nullified if the IARM is damaged, contaminated, otherwise modified, or used in a manner for which it was not intended.

Instructions for Use: The test surface is on the side opposite to the labeled surface, which includes the IARM number. The entire thickness of the unit is certified. However, the user is cautioned not to measure disks less than 2 mm thick when using X-ray fluorescence spectrometry. Each packaged disk has been prepared by finishing the test surface using a lathe. The user must determine the correct surface preparation procedure for each analytical technique. The user is cautioned to use care when either resurfacing the disk or performing additional polishing, as these processes may contaminate the surface. The minimum sample size for chips should be individually evaluated based on the analytical technique used; this would typically be greater than 0.1 grams. The material should be stored in a cool, dry location when not in use. Chips are not to be used for Oxygen analysis.

Selection of Materials: A "batch" or "series" is defined as a continuous length of bar produced from a single heat. The majority of IARM materials are in wrought condition; other methods of manufacture are utilized if necessary. ILAP samples are removed from equal sections from the total length of the bar. A portion of each section is converted to chips and a thin (pin) disk for analysis by classical wet chemistry, ICP, AA, and combustion procedures, and the balance remains as a thick disk for OES and X-Ray analysis.

David Coler, General Manager Analytical Reference Materials International



Analytical Reference Materials International • 276 Abby Road • Manchester, NH 03103252F-01312018-IARM-FTelephone (603) 935-4100 • Fax (603) 935-4101 • www.ARMI.com • ARMI@LGCgroup.com1/31/2018 3 / 3